

System reliability for condition evaluation of bridges

Autor(en): **Estes, Allen C. / Frangopol, Dan M.**

Objektyp: **Article**

Zeitschrift: **IABSE reports = Rapports AIPC = IVBH Berichte**

Band (Jahr): **76 (1997)**

PDF erstellt am: **23.07.2024**

Persistenter Link: <https://doi.org/10.5169/seals-57459>

Nutzungsbedingungen

Die ETH-Bibliothek ist Anbieterin der digitalisierten Zeitschriften. Sie besitzt keine Urheberrechte an den Inhalten der Zeitschriften. Die Rechte liegen in der Regel bei den Herausgebern.

Die auf der Plattform e-periodica veröffentlichten Dokumente stehen für nicht-kommerzielle Zwecke in Lehre und Forschung sowie für die private Nutzung frei zur Verfügung. Einzelne Dateien oder Ausdrucke aus diesem Angebot können zusammen mit diesen Nutzungsbedingungen und den korrekten Herkunftsbezeichnungen weitergegeben werden.


Das Veröffentlichen von Bildern in Print- und Online-Publikationen ist nur mit vorheriger Genehmigung der Rechteinhaber erlaubt. Die systematische Speicherung von Teilen des elektronischen Angebots auf anderen Servern bedarf ebenfalls des schriftlichen Einverständnisses der Rechteinhaber.

Haftungsausschluss

Alle Angaben erfolgen ohne Gewähr für Vollständigkeit oder Richtigkeit. Es wird keine Haftung übernommen für Schäden durch die Verwendung von Informationen aus diesem Online-Angebot oder durch das Fehlen von Informationen. Dies gilt auch für Inhalte Dritter, die über dieses Angebot zugänglich sind.

System Reliability for Condition Evaluation of Bridges

Allen C. ESTES
Graduate Student
Univ. of Colorado
Boulder, CO, USA

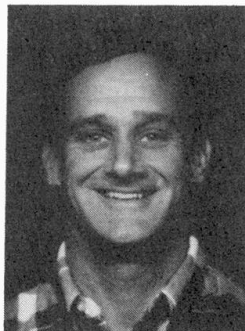

Allen C. Estes is a Lieutenant Colonel in the U.S. Army Corps of Engineers and is working toward his Ph.D. in Structural Engineering at the University of Colorado.

Dan M. FRANGOPOL
Professor
Univ. of Colorado
Boulder, CO, USA



Dan M. Frangopol is Professor of Civil Engineering at the University of Colorado. He received his civil engineering degrees from the Institute of Civil Engineering, Bucharest, Romania (1969) and the University of Liege, Belgium (1976). His research activities include reliability analysis and design of buildings and bridges, bridge management systems, and structural optimization.

Summary

For many bridges which were designed and built before structural reliability methods were applied to structural design, there is an urgent need to quantify their safety from a system reliability viewpoint. Optimum inspection, repair, and replacement strategies need to be developed based on minimizing the expected cost of keeping the system reliability above the established target level during the anticipated remaining service life of these bridges. These strategies need to be updated over time through timely inspections based on changing conditions. This study proposes a methodology for a system reliability-based condition evaluation of existing highway bridges. The approach is illustrated for an existing steel bridge located in Colorado. The initial optimum repair strategy is updated using both biennial visual inspections and specific non-destructive evaluation testing.

1. Introduction

Over the past several decades, the concepts and methods of structural reliability have developed rapidly and become widely accepted among researchers and increasingly acknowledged among practicing engineers. The United States has a national inventory of almost 600,000 highway bridges, many of which have deteriorated substantially and will require large expenditures to repair. A system reliability approach to optimizing the inspection and repair of these bridges will provide a more efficient use of the scarce funding resources by providing an acceptable level of safety at a minimum expected cost. For many bridges which were designed and built before structural reliability methods were applied to structural design, there is an urgent need to quantify their safety from a system reliability perspective.

This study proposes a methodology for condition evaluation of existing highway bridges based on system reliability. The technique is illustrated using State Highway Bridge E-17-AH, located in the metro Denver area of Colorado. An optimum lifetime repair strategy is developed for the bridge by minimizing the expected lifetime cost and maintaining a prescribed level of system safety throughout the life of the bridge. This repair strategy is only as valid as the assumptions that were made when the bridge was placed in service. The repair strategy must be updated and revised throughout the life of the bridge based on the results of periodic inspections. The methodology for revising the repair strategy for Bridge E-17-AH is developed based on both the mandatory biennial visual inspections and some specific non-destructive evaluation (NDE) testing.



2. System reliability approach to the repair optimization of an existing highway bridge

A time-dependent system reliability approach is applied to optimize the repair strategy for an existing highway bridge (Colorado State Highway Bridge E-17-AH). The bridge is on State Highway 33 in Denver, Colorado, and has three 13.36 m simply-supported steel-concrete composite spans. The 12.18 m wide roadway carries four lanes of traffic with an Average Daily Traffic (ADT) of 8500 vehicles. The deck is reinforced concrete and the steel girders are standard rolled shapes with simple-span supports. The interior span supports are reinforced concrete pier columns with a pier cap, four supporting square tapered columns, and individual column footings. The concrete abutments are supported by concrete piles cased in steel. A local railroad spur runs underneath the bridge. The cross section of the superstructure is shown in Fig.1(a) where the girders are classified as exterior (E), interior-exterior (I-E), and interior (I).

Using 24 separate random variables, the intact bridge was analyzed with respect to 16 different failure modes including moment failure of the slab, moment and shear failure of the girders, and multiple failure modes of the pier cap, columns and footings. Limit state equations were developed and the reliability of each component was computed separately. The bridge system was modeled as a series-parallel model. Both the component reliabilities and the system reliability of the bridge were computed. A simplified system model for the bridge where it is assumed that the superstructure will not fail until three adjacent girders have failed is shown in Fig. 1(b). The simplifying assumptions, a more refined model, and a complete description of these calculations are given in Estes [5].

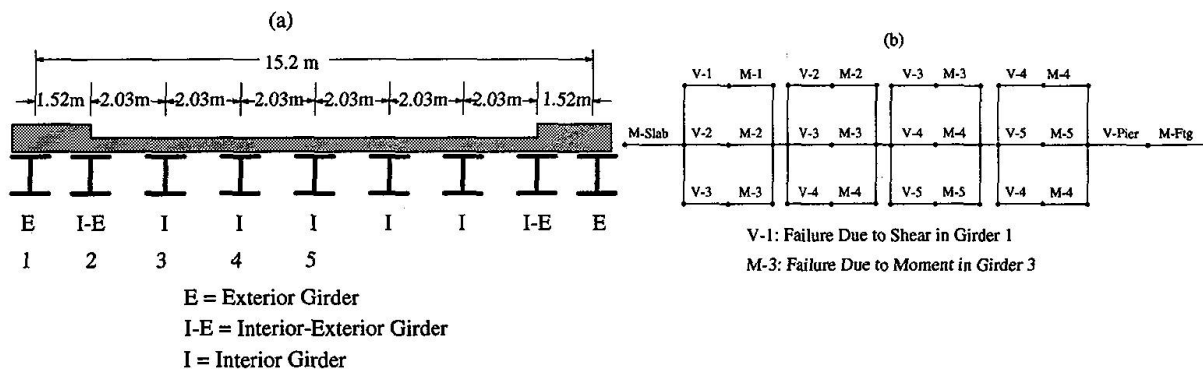


Fig. 1 Colorado State Highway Bridge E-17-AH: (a) Designation of girders, and (b) Simplified series-parallel model

The reliability of the bridge system is decreasing over time as the live load increases and the structure deteriorates. The time-dependent live-load shear and moment effects are a function of the length of the span, the average daily truck traffic, and the shear and moment caused by an AASHTO HS-20 truck as proposed by Nowak [9]. It is assumed that the slab and pier cap deteriorate due to the penetration of chlorides through the concrete as suggested by Thoft-Christensen [11]. Corrosion begins once the chlorides reach a critical threshold concentration at the level of the reinforcing steel. The time required for corrosion to begin is the corrosion initiation time T_I . The rate of corrosion r_{corr} determines the amount of section loss in the reinforcing steel over time. The girders are corroding using the model developed by Albrecht and Naeemi [1]. The corresponding section loss reduces the web area and plastic section modulus over time. This reduces the girder shear and moment capacities, respectively. The deterioration process introduces new random variables into the limit state equations which include diffusion rates, chloride surface concentration, and corrosion parameters.

A minimum allowable (i.e., target) lifetime system reliability index $\beta_{T,system\ life} = 2.0$ is established. The bridge is inspected every two years and anytime the system reliability of the bridge falls below the prescribed minimum, some type of repair or replacement must be made. After considering the initial cost of the bridge, Colorado Department of Transportation (CDOT) cost documents [3] and conversations with experts at CDOT, the following repair options and their associated present day (1996) costs were established: (a) Option 0: Do nothing \rightarrow \$0; (b) Option 1: Replace deck \rightarrow \$225,600; (c) Option 2: Replace exterior two girders (E and I-E in Fig. 1(a)) \rightarrow \$229,200; (d) Option 3: Replace exterior two girders and entire deck \rightarrow \$341,800;

(e) Option 4: Replace entire superstructure → \$487,100; and (f) Option 5: Replace entire bridge → \$659,900.

For option 1 (replace deck), Fig.2 shows the time-dependent reliabilities of the bridge system and of all components shown in Fig. 1(b). The deck is replaced when $\beta_{system} \leq 2.0$. Consequently, the deck is replaced twice at years 50 and 94 of the bridge life. At year 106, a deck replacement is not sufficient to improve β_{system} to a value larger than 2.0. Due to the parallel nature of the system, the reliability of some components are allowed to fall below $\beta_{T,system\ life} = 2.0$. Due to varying deterioration rates, the critical component early in the life of the structure is not necessarily the most important later on.

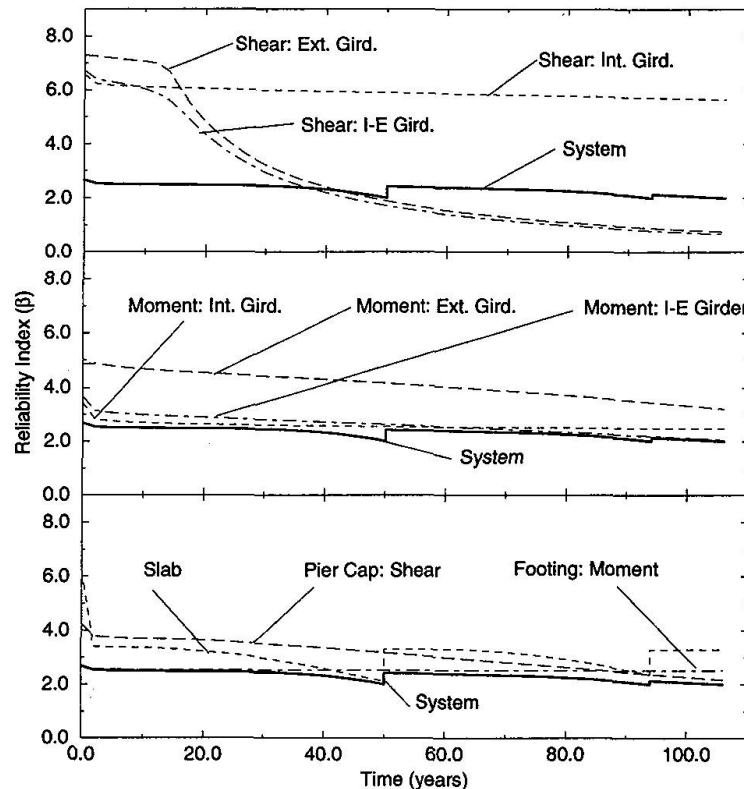


Fig. 2 Results of repair option 1: Replace deck on Bridge E-17-AH using series-parallel system model requiring the failure of three adjacent girders

Let's assume the bridge is placed in service in 1996. Accounting for all combinations of options and using an assumed discount rate of 2%, the possible repair strategies and their associated present value costs are shown in Fig. 3. The analysis continued until replacement of the bridge (i.e., option 5) becomes the only available solution. From Fig. 3, the optimum strategy can be determined for the expected life of the bridge. For example, for a life of 50 years, no action should be taken; for 50-94 years, replace the deck at year 50 (\$83,813); 94-106 years, replace the deck at year 50 and year 94 (\$118,881); 106-108 years, replace the slab at year 50 then replace the exterior two girders and slab at year 94 (\$136,945); and after 108 years, replace the slab at year 50 then replace the bridge at year 94 (\$186,393).

The bridge was analyzed for several different series-parallel system models where the failure of two adjacent girders or failure of a single girder would cause failure of the superstructure. Other parameters such as random variable correlation, deterioration rates, and discount rates were varied and often produced very different results. A repair strategy based on uncertain information must be updated throughout a structure's life based on inspection results. Without a series of specialized tests, the reliability of the bridge when placed in service is based on the same information available to the designer. During the design phase of a structure, the random variables are based on data from other projects, manufacturer specifications, and available literature. For an existing structure, the availability of material tests and field measurements can improve the knowledge of random variables.

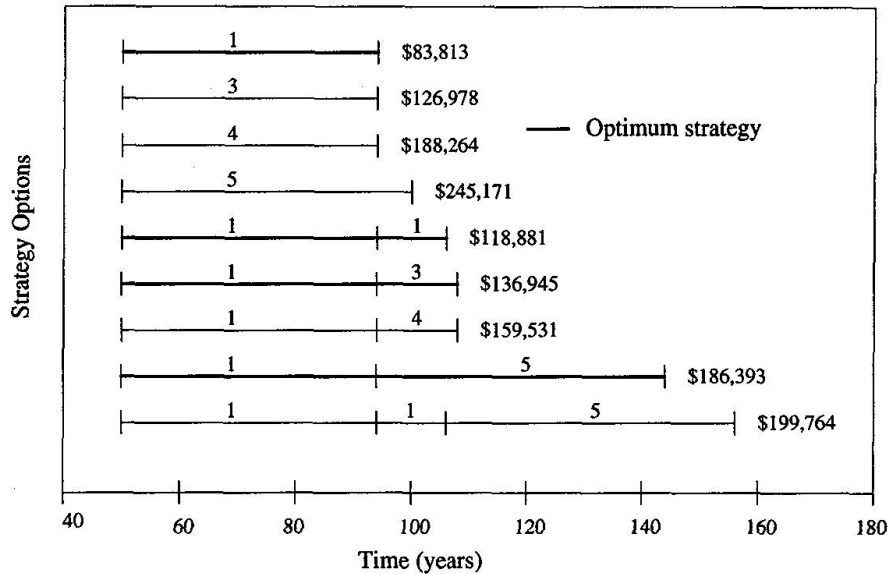


Fig. 3 Strategy options and associated costs

The reliability of a structure can be improved by increasing the capacity of the members, reducing the demand on the structure, or reducing the uncertainty in the random variables. In general, many uncertainties are site specific and if a structure already exists, these uncertainties are lower than those at the design stage [12]. By conducting tests to determine the actual strength of the steel, the unit weight of the concrete, the live-load traffic pattern, the girder distribution factors, or the thickness of the asphalt, the results may allow the subjective uncertainties to be reduced, or even eliminated, and should at least improve the knowledge of the mean value and degree of dispersion of the random variables. A sensitivity analysis of the random variables would help indicate which tests would produce the greatest benefit. This study, however, is limited to updating the effects of the time-dependent deterioration and updating the chosen deterioration models.

3. Updating the system reliability from the biennial visual inspections

In the United States, all bridges in the National Bridge Inventory (NBI) must be inspected every two years. The results are reported to the Federal Highway Administration (FHWA) and are maintained in a national data base. The minimum reporting requirement is to provide a condition state which ranges from 9 (excellent condition) to 0 (failed condition) for the bridge deck, superstructure, and substructure. As bridge management has improved over the past two decades, many states have adopted bridge management systems and more detailed inspections which provide much more information about an individual bridge. The PONTIS Bridge Management System [4] has been adopted by many states and assigns condition ratings to many elements of a bridge. These bridge elements incorporate components such as railings, joints and decks; types of materials such as concrete, steel, or timber; and other relevant information such as protected or unprotected decks, open or closed girders, and painted or unpainted stringers.

In the PONTIS system, each bridge element is visually inspected by a trained inspector and classified into one of five condition states, although some elements have fewer condition states. The five condition ratings for Element 107: Painted Open Steel Girders [4] are shown in Table 1. Updating the reliability of a bridge based on visual inspections is only possible if the conditions states are specific and quantifiable. The condition states in Table 1 rely on rust codes *R1* through *R4* to quantify the percent section loss.

CS	Description	Rust Code
1	No evidence of active corrosion. Paint system is sound and protecting the girder.	-
2	Slight peeling of the paint, pitting, or surface rust, etc. No section loss.	light <i>R1</i>
3	Peeling of the paint, pitting, surface rust, etc. No section loss.	<i>R1</i>
4	Flaking, minor section loss (<10% of original thickness).	<i>R2</i>
4	Flaking, swelling, moderate section loss (>10% but ≤ 30% of the original thickness). Structural analysis not warranted.	<i>R3</i>
5	Flaking, swelling, moderate section loss (>10% but ≤ 30% of the original thickness). Structural analysis is warranted due to location of corrosion on the member.	<i>R3</i>
5	Heavy section loss (>30% of original thickness), may have holes through the base metal.	<i>R4</i>

Table 1. CDOT suggested Condition State (CS) ratings for Element 107: painted open steel girders [4]

The location of the damage also must be known. A segment-based inspection first proposed by Renn [10] is used here where the location of all damage on the structure is identified. On the simple-span Bridge E-17-AH, for example, the corrosion near the supports affects the area of the web which reduces the shear capacity of the girder. The corrosion in the center of the girder reduces the plastic section modulus which is critical to the moment capacity. Furthermore, identifying whether the damage is on an exterior, interior-exterior, or interior girder also affects the system reliability.

The parameters of random variables cannot be obtained directly from a visual inspection. Some assumptions must be made regarding the accuracy of the results and quality of the information provided by the inspectors. This study assumes that condition state deterioration over time is linear and that the deterioration intensity is normally distributed. It is further assumed that when a bridge element is at the halfway point of a specific condition state, the mean value of the normal distribution is at the halfway point of the condition state definition (see Fig. 4).

The standard deviation is determined by the assumed quality of the inspection program. If the inspector is believed to be correct 90% of the time when the member is at the halfway point of the condition state, then 90% of the values in the normal distribution will be within the values prescribed by the condition state. To make this assumption conservative, the condition state is assumed to begin at the halfway point and shifts progressively to the right as shown in Fig. 4. If the element remains in the condition state longer than expected, the distribution will remain at the far right position until an inspection reveals a switch to the next condition state. The exception will be for the first and final condition states where a lognormal distribution is used.

This study considered three different qualities of inspection programs, A, B, and C, where the inspectors were provided the correct rating 95%, 85%, and 75% of the time, respectively. The quality of the inspection program was determined based on seven criteria [5] which included inspector training, a quality assurance program, and inspector experience. The density distributions associated with condition states 1 through 5 for Inspection Category A and Element 107 as listed in Table 1 are shown in Fig. 5. Condition states 1, 2, and 3 were modified to reflect section losses of 0-2%, 0-5%, and 0-10%, respectively. Once the parameters of the random variables which describe the percent section loss for the corroding steel girders are defined, the area of the web and the plastic section modulus at the time of inspection can be computed. With the revised shear and moment capacities of the girders, the updated reliability of the bridge girders is computed. Assuming linear condition state deterioration over time, the future performance of the structure is predicted.

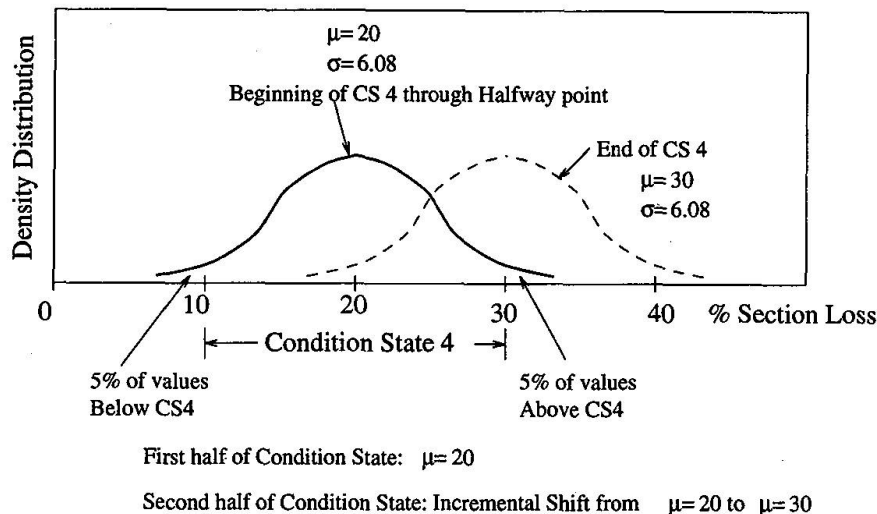


Fig. 4 Density distribution of deterioration for Element 107 in Condition State 4 when inspectors are correct 90% of the time.

Unfortunately, an update of the deck or the superstructure was not possible based on a visual inspection. The PONTIS inspection was only able to report the number of cracks, degree of efflorescence, and percentage of surface spalls. While this information is valuable for assessing the general surface condition of the deck or the pier cap, the information was not sufficient to infer the randomness of the section loss in the corroding steel reinforcement embedded in the concrete. A series of NDE inspections are needed to update the reliability of the deck.

4. Reliability updates based on Non-Destructive Evaluation (NDE) methods

While the biennial visual inspections evaluate the entire bridge, a program of NDE tests focuses on particular defects in specific areas. The tests must be selected to provide the relevant information needed to update the reliability. In this study, the thickness of the girder flanges is measured using calipers or a micrometer to obtain actual section loss. For the deck, half-cell potential tests provide the degree of active corrosion and allow the corrosion initiation time T_I to be updated. The rate of corrosion r_{corr} is then assessed using three-electrode linear polarization (3LP) test results. Because these tests were never actually conducted on Bridge E-17-AH, the inspection results from other similar structures were applied to this bridge to illustrate the updating process.

4.1 Thickness of the girders

Thickness readings on the girders were taken at numerous locations on the girders after 15, 30, and 55 years of service. The mean and standard deviation of the corrosion depth d_{corr} (in mm) were established for each type of girder (interior, interior-exterior, and exterior) for each inspection. The same format as the original deterioration model was used where time t is in years :

$$d_{corr} = A_0 t^{A_1} \quad (1)$$

The corrosion parameters A_0 and A_1 were computed by a curve fit through the data points, producing the following results:

$$\begin{aligned} d_{corr: exterior} &= 0.13218 t^{0.595478} \\ d_{corr: int.-ext.} &= 0.12151 t^{0.568652} \\ d_{corr: interior} &= 0.03015 t^{0.690171} \end{aligned}$$

A comparison of the revised corrosion model with the original corrosion model [1] reveals that the actual rates of corrosion were slightly higher than predicted for the exterior girders, slightly lower than predicted for the interior-exterior girders, and almost the same for the interior girders. The inspection results produced a smaller standard deviation of thickness loss for all types of girders. This reduced uncertainty in thickness loss improves the reliability of the girders.

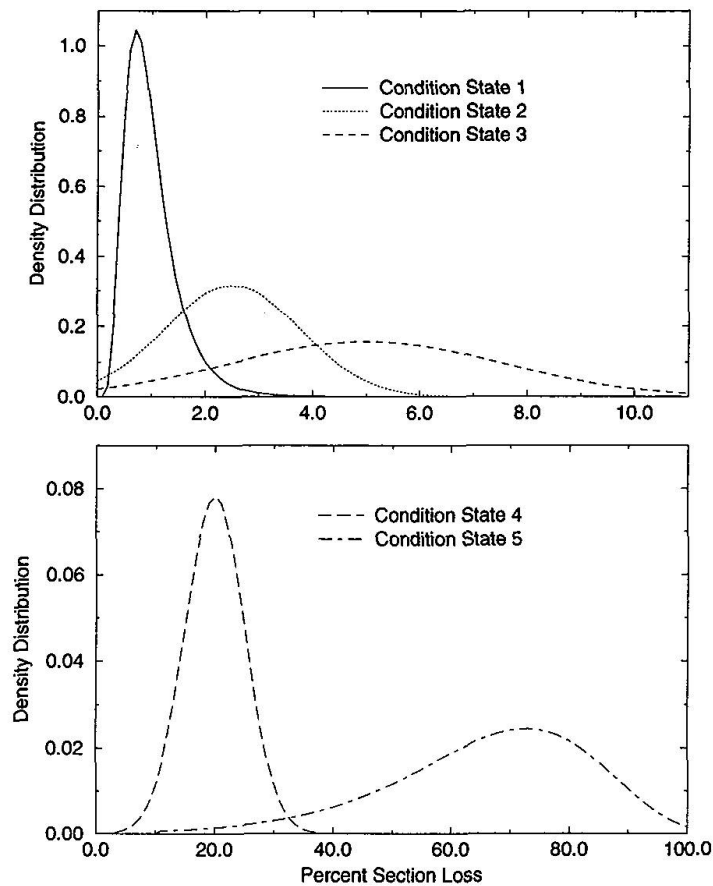


Fig. 5 Density distributions associated with Condition State (CS) ratings CS1-CS5 for Element 107: painted open steel girders, Inspection Category A

4.2 Section loss in the deck reinforcement

The half-cell potential test is conducted to obtain the percentage of the deck experiencing active corrosion. The half-cell potential survey measures the electrical potential difference between a standard portable copper-copper sulfate half-cell placed on the surface of the concrete and the embedded reinforcing steel. A potential reading more positive than -0.20 volts indicates a 90% chance of no active corrosion at the point the reading is taken. A reading more negative than -0.35 volts indicates a 90% chance that active corrosion is underway. Readings between these values are considered uncertain. By plotting a cumulative distribution of the half-cell readings throughout the deck and making a linear approximation in the uncertain range as shown in [6], the percent of the deck which is damaged can be assessed. By performing the test at several points in time, the chloride initiation time and its updated distribution can be determined as detailed by Estes [5]. In this study, the updated initiation time T_I was :

$$\mu_{T_I} = 49.0 \text{ years and } \sigma_{T_I} = 15.0 \text{ years.}$$

The original deterioration model predicted :

$$\mu_{T_I} = 19.6 \text{ years and } \sigma_{T_I} = 7.5 \text{ years.}$$

While the half-cell potential test indicates if active corrosion has begun, the corrosion rate determines the amount of section loss in the reinforcing steel which results in diminished moment capacity and reduced reliability. The three-electrode linear polarization test (3LP) uses polarization resistance to determine the amount of electrical current flowing in actively corroding reinforcement. If a large flow of current is required to cause a specific change in electrical potential, the bar is corroding at a high rate. Conversely, if a small current flow is needed to cause the same change in potential, the bar is corroding more slowly. These current readings can be converted to corrosion rates as described by Clear [2].



Using current readings taken at 38 locations on the structure and using only those readings where the half-cell potential was more negative than -0.35 volts, the updated parameters of the corrosion rate r_{corr} for the embedded deck reinforcement are :

$$\mu_{r_{corr}} = 48.5 \text{ } \mu\text{m/yr and } \sigma_{r_{corr}} = 29.9 \text{ } \mu\text{m/yr.}$$

The values for r_{corr} from the original deterioration model [11] were :

$$\mu_{r_{corr}} = 50.7 \text{ } \mu\text{m/yr and } \sigma_{r_{corr}} = 5.8 \text{ } \mu\text{m/yr.}$$

The mean value of the corrosion rate is only slightly less than the original model but the standard deviation is about five times higher. Contrary to the expected result from [12] where testing is expected to reduce the uncertainty, these test results represent an exception where inspection results provide greater uncertainty in a random variable. With revised values for the corrosion initiation time T_I and the rate of corrosion r_{corr} , the reliability of the slab can be updated.

4.3 Reliability update of the bridge

Using the results of NDE inspections, the reliability of the girders, the deck, and ultimately the system are updated. Using the same repair options listed earlier, Fig. 6 shows the results of Option 1: Replace the Deck. Fig. 6 can be compared to Fig. 2 which showed the time-dependent reliability of the bridge components and bridge system when the deck was replaced twice using the original deterioration models. Despite the updated inspection results, the figures are quite similar, except for the reliabilities with respect to girder shear. The girder reliabilities with respect to moment are close to the original model. The moment capacity is dependent on the plastic section modulus which is less sensitive to the small changes in the thickness loss. In Fig. 6, the slab is replaced at year 52 and year 98, and at year 108, a slab repair is no longer sufficient to raise the system reliability above $\beta_{min}=2.0$.

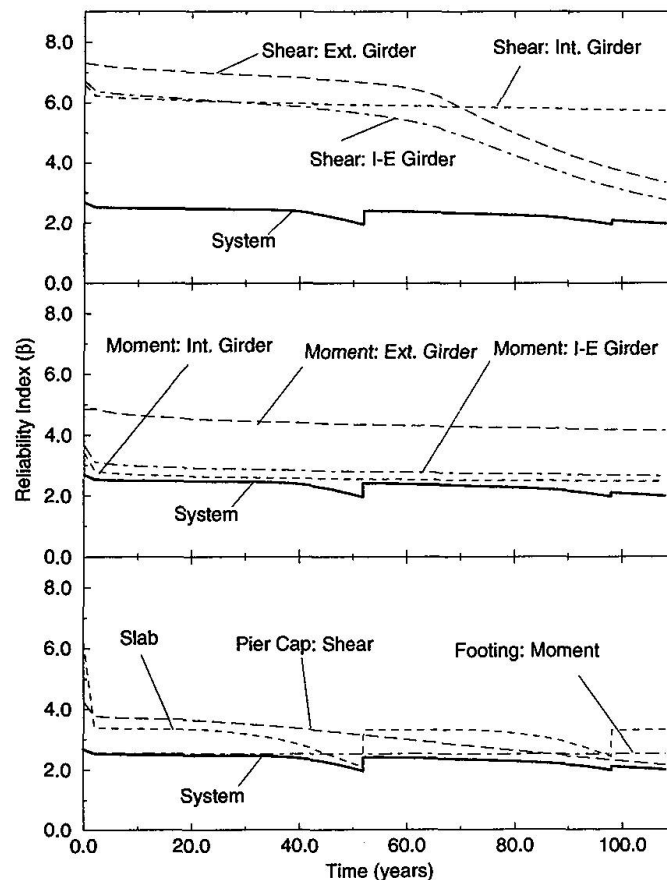


Fig. 6 Updated results of repair option 1 on Bridge E-17-AH using simplified series-parallel model requiring the failure of three adjacent girders

With regard to the reliability of the system, the girder reliabilities do not dominate the system. The reduced girder corrosion rate uncertainty improves the reliability of the individual girders, but has little to no effect on the system. The slab, which is deteriorating more rapidly than the other critical failure modes, eventually dominates the reliability of the system. The effects of longer chloride initiation time T_I and increased uncertainty in the corrosion rate r_{corr} offset each other. As a result, the minimum system reliability $\beta_{min} = 2.0$ is violated after 52 years of service, which is very close to the 50 years of service in the earlier model. Again, accounting for all relevant repair possibilities and using a discount rate of 2%, Fig. 7 shows all feasible strategy options and their associated costs which can be compared to Fig. 3 using the original model.

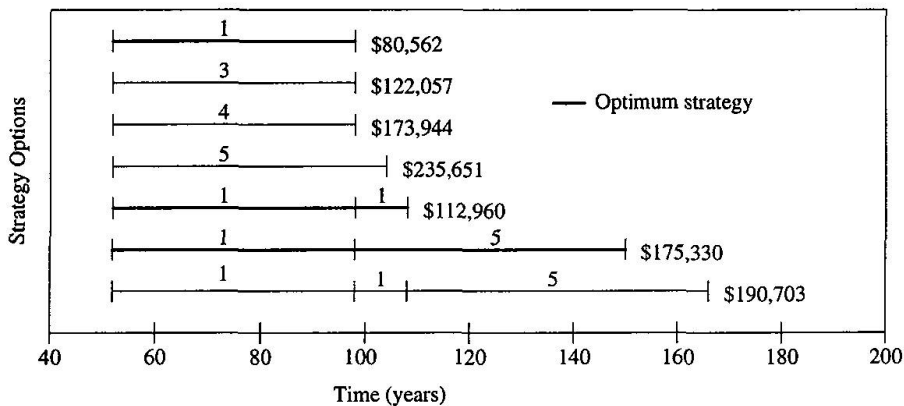


Fig. 7 Updated strategy options and costs (2% discount rate) for Bridge E-17-AH using simplified series-parallel model requiring the failure of three adjacent girders

As a result, the updated optimum strategy is as follows: for a life of 52 years, no action should be taken; for 52-98 years, replace the deck at year 52 (\$80,562); 98-108 years, replace the deck at year 52 and replace the deck again at year 98 (\$112,960); and after 108 years, replace the slab at year 52 and replace the bridge at year 108 (\$175,330). Updated inspection results would not always produce such minor changes in strategy. The lack of change in this update is due to the compensating differences in the deck results where the positive effect of an increased chloride initiation time was offset by a more uncertain corrosion rate. If the slab had been deteriorating more slowly and the girders more rapidly than the model suggested, then the updated lifetime bridge repair strategy would have been quite different.

5. Concluding remarks

Using Colorado State Highway Bridge E-17-AH, this study illustrated how system reliability methods can be used to optimize the lifetime repair strategy while minimizing total cost and maintaining a prescribed level of system reliability. Because the initial strategy is based on assumptions that must be verified over the life of the structure, inspection results can be used to update the reliability of the structure and the repair strategy. With some reasonable assumptions, the biennial visual inspections can be used, but often the information provided is not sufficient or the condition states are not well enough defined to update the reliability. The reliability update of a structure can be completed with much greater confidence if specific NDE inspection techniques are used to provide the relevant information. In this case, thickness tests, half-cell potential readings, and three-electrode linear polarization (3LP) methods were used to update the reliability of the deck and the girders.

With the relevant NDE inspection techniques identified, the next step is to determine the optimum number and timing of these inspections over the life of the structure to minimize the life-cycle cost. As an example, Estes [5] uses a given deck structure and optimizes the number of lifetime inspections and their intervals for the half-cell potential test. There has been tremendous progress in applying reliability-based methods to optimize bridge management. As reliability theory has become better understood and accepted, the trend in research has moved toward more realistic and practical applications [7, 8]. This study is just one example of a reliability-based application which improves the life-cycle cost analysis of bridges.



Acknowledgments

This material is based upon work partially supported at the University of Colorado by the United States National Science Foundation under Grant Nos. CMS-9319204, CMS-9506435, CMS-9522541, and CMS-9522166. This support is gratefully acknowledged. Also, the support from the U.S. Army for the first author is gratefully acknowledged. The results, opinions and conclusions expressed in this paper are solely those of the authors and do not necessarily represent those of the sponsors.

References

1. ALBRECHT, P., NAEEMI, A.H. Performance of Weathering Steel in Bridges, National Cooperative Highway Research Program, Report 272, 1984.
2. CLEAR, K.C. "Measuring Rate of Corrosion of Steel in Field Concrete Structures." Transportation Research Record 1211, Transportation Research Board, National Research Council, Washington D.C., 1992.
3. CDOT: Colorado Department of Transportation. 1994 Cost Data, Cost Estimates Unit, Staff Design Branch, Denver, Colorado, 1995.
4. CDOT: Colorado Department of Transportation. BMS/PONTIS Bridge Inspection Manual. Denver, Colorado, 1995.
5. ESTES, A.C. A System Reliability Approach to the Lifetime Optimization of Inspection and Repair of Highway Bridges. Ph.D. Thesis, Department of Civil, Environmental, and Architectural Engineering, University of Colorado, Boulder, Colorado (in progress).
6. FHWA: Federal Highway Administration, Corrosion Detection in Reinforced Concrete Bridge Structures, User Manual, Demonstration Project No. 84, U.S. Department of Transportation, Washington D.C., 1992.
7. FRANGOPOL, D.M., HEARN, G. "Managing the Life-Cycle Safety of Deteriorating Bridges," Recent Advances in Bridge Engineering (Edited by J.R. Casas, F.W. Klaiber, and A.R. Mori), CIMNE, Barcelona, 1996, 38-55.
8. FRANGOPOL, D.M., LIN, K.Y., ESTES, A.C. "Reliability of Reinforced Concrete Girders Under Corrosion Attack," Journal of Structural Engineering, ASCE, New York, 123(3), 1997.
9. NOWAK, A.S. "Load Model for Bridge Design Code", Canadian Journal of Civil Engineering, Vol. 21, No. 1, 1994, pp. 36-49.
10. RENN, D.P. Segment-Based Inspection for Load Rating Within Bridge Management Systems, Master of Science Thesis, Department of Civil, Environmental and Architectural Engineering, University of Colorado, Boulder, Colorado, 1995.
11. THOFT-CHRISTENSEN, P., JENSEN, F.M., MIDDLETON, C.R., BLACKMORE, A. "Assessment of the Reliability of Concrete Slab Bridges," Proceedings of the 7th IFIP WG7.5 Working Conference, Boulder, Colorado, April 2-4, 1996, in Reliability and Optimization of Structural Systems (Edited by D.M. Frangopol, R.B. Corotis, R. Rackwitz, Elsevier, 1996 (in print).
12. VERMA, D., MOSES, F. "Bridge Reliability - Evaluation vs. Design." Probabilistic Methods in Civil Engineering (Edited by P.D. Spanos), ASCE, New York, 1986, pp. 233-236.