

**Zeitschrift:** IABSE congress report = Rapport du congrès AIPC = IVBH  
Kongressbericht

**Band:** 12 (1984)

**Artikel:** Aerodynamic stability of long-span box girder

**Autor:** Tanaka, A. / Miyashita, C. / Nomura, N.

**DOI:** <https://doi.org/10.5169/seals-12247>

### **Nutzungsbedingungen**

Die ETH-Bibliothek ist die Anbieterin der digitalisierten Zeitschriften. Sie besitzt keine Urheberrechte an den Zeitschriften und ist nicht verantwortlich für deren Inhalte. Die Rechte liegen in der Regel bei den Herausgebern beziehungsweise den externen Rechteinhabern. [Siehe Rechtliche Hinweise.](#)

### **Conditions d'utilisation**

L'ETH Library est le fournisseur des revues numérisées. Elle ne détient aucun droit d'auteur sur les revues et n'est pas responsable de leur contenu. En règle générale, les droits sont détenus par les éditeurs ou les détenteurs de droits externes. [Voir Informations légales.](#)

### **Terms of use**


The ETH Library is the provider of the digitised journals. It does not own any copyrights to the journals and is not responsible for their content. The rights usually lie with the publishers or the external rights holders. [See Legal notice.](#)

**Download PDF:** 15.03.2025

**ETH-Bibliothek Zürich, E-Periodica, <https://www.e-periodica.ch>**

# AERODYNAMIC STABILITY OF LONG-SPAN BOX GIRDER

Tozaki Bridge is the north approach to Ohnaruto Br. (suspension bridge) of Kobe-Naruto Route, Honshu-Shikoku Bridge Project, Japan. Tozaki Bridge is 2 sets of continuous box girders and has slender configuration with large overhanging brackets.

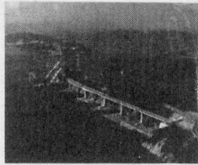

The bridge was to be constructed along a steep ridge called Tozaki which faces the Pacific Ocean. Thus, strong wind is expected so that the basic wind speed which is defined as 10 minutes average speed expected to occur once or twice in 150 years is decided to be 50m/s. And, bad influence by the topography was also anxious.

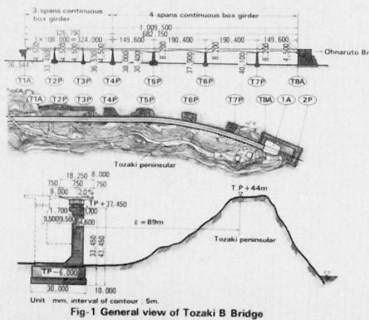


Fig-1 General view of Tozaki B Bridge

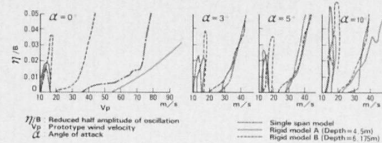


Fig-2 Response of original section (without topography)

The original section was suspected to have unstable aerodynamic behavior, so, wind tunnel tests were conducted to reveal that the original section had vortex-induced oscillation at the wind speed of 15 to 20 m/s and galloping which should not occur below the speed of 92 m/s (10minutes average), the dynamic design wind speed.

Various stabilizers and their effects were tested in wind tunnels.

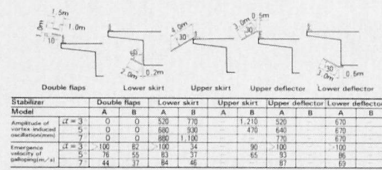


Table 1 Various stabilizers and their effects (rigid models)




Fig-3 Effect of lower skirt (model B)




Fig-4 Effect of flap (model A)

As the results of a series of wind tunnel testings, the final stabilizers were determined as follows: Double flaps were attached to the whole length of the bridge in order to restrict the amplitude of vortex-induced oscillation less than 200 mm ( $H/B=0.01$ ) which was the allowable value from the viewpoint of fatigue and runnability of automobiles. And, intermittent lower skirts to suppress galloping which might destroy the bridge in a short time if it appeared were provided to the 4-spans continuous girder. After the completion of the bridge in the summer of 1983, oscillation and wind have been observed, but no considerable oscillation has been generated so far, because no strong wind beyond 20 m/s has unfortunately blown.

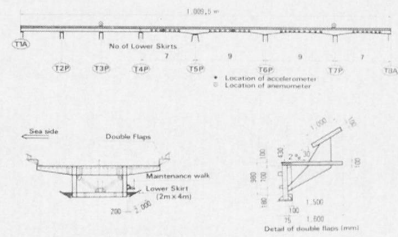


Fig-5 Actually adopted stabilizers and location of sensors

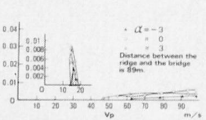


Fig-6 Response of improved section (single span model with topography)

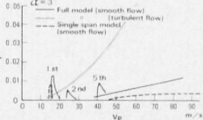


Fig-7 Response of improved section (elastic models in smooth or turbulent flow)