Zeitschrift:	IABSE congress report = Rapport du congrès AIPC = IVBH Kongressbericht
Band:	12 (1984)
Artikel:	Load variations in bridge falsework
Autor:	Quinion, D.W.
DOI:	https://doi.org/10.5169/seals-12250

## Nutzungsbedingungen

Die ETH-Bibliothek ist die Anbieterin der digitalisierten Zeitschriften. Sie besitzt keine Urheberrechte an den Zeitschriften und ist nicht verantwortlich für deren Inhalte. Die Rechte liegen in der Regel bei den Herausgebern beziehungsweise den externen Rechteinhabern. <u>Siehe Rechtliche Hinweise.</u>

## **Conditions d'utilisation**

L'ETH Library est le fournisseur des revues numérisées. Elle ne détient aucun droit d'auteur sur les revues et n'est pas responsable de leur contenu. En règle générale, les droits sont détenus par les éditeurs ou les détenteurs de droits externes. <u>Voir Informations légales.</u>

### Terms of use

The ETH Library is the provider of the digitised journals. It does not own any copyrights to the journals and is not responsible for their content. The rights usually lie with the publishers or the external rights holders. <u>See Legal notice.</u>

**Download PDF:** 15.03.2025

ETH-Bibliothek Zürich, E-Periodica, https://www.e-periodica.ch

### Load Variations in Bridge Falsework

# D.W. QUINION

Chief Engineer Tarmac Construction Limited Wolverhampton, England

## Construction Method

It was necessary to construct the concrete box girder section on a multitude of tubular steel members using a proprietary frame system because of the complex geometry of the bridge and the heavy loads to be carried. The four spans are unequal, the bridge has a reverse curve on plan and it is on a vertical curve. The east abutment is adjacent to a disused railway tunnel whilst the west abutment is on the top of a steeply inclined schist slope which has a river at its foot. In the more heavily loaded areas there were 26 lines of tubular supports, many of which were expected to receive safe maximum working loads.

The box construction, up to 6.3 m overall depth, was constructed in 10 m lengths of bottom slab, walls and then road deck. After the first span and a quarter had been concreted and had matured, it was post-tensioned using a stressing gap whilst concreting continued westwards. The gap was then filled. This procedure was followed for three spans.

### Design of Falsework

The falsework supports were designed to withstand the dead load of the concrete work plus the imposed loadings during construction immediately above, together with the distributed wind load from wind speeds of 46 m per second with reduction factors. The wind load calculations based on the Code for permanent structures gave unrealistic answers and questioning led to evaluation of a more relevant design approach to wind loads on multi-tubular frameworks.

The bridge designer was involved in the assessment of likely vertical movements of the bridge as post tensioning was carried out. Whilst the first two operations were predicted to give small acceptable movements, the third span cantilever was predicted to rise by 55 mm and the rotation about the adjacent pier would increase the load in the Falsework east of it. The difficulty of assessing the magnitude of this increase and the risk to the safety of the Falsework for use here or elsewhere led to the use of load-measuring gauges to monitor the load history in the more critical area.

### Load History


As concrete construction progressed the loads in the Falsework increased and approached the design values. As the concrete matured and particularly after a span was completed, the loads dropped in the Falsework as some 20% was transferred to the piers.

During post tensioning the third cantilever end rose by 76 mm and the adjacent span moved 14 mm downwards. The loads on the measured members rose by 25% from their previous values.

Subsequently, during removal of the Falsework the loads in some of the members which were the last to be fully relieved of load increased by a further 25%.

### Summary

The measurements of the load history in the Falsework have shown the significance of post tensioning movements on supporting temporary works and the need to assess them. Monitoring of this kind is not only of value to future designs but enables safe control of Falsework to be demonstrated as the work proceeds.

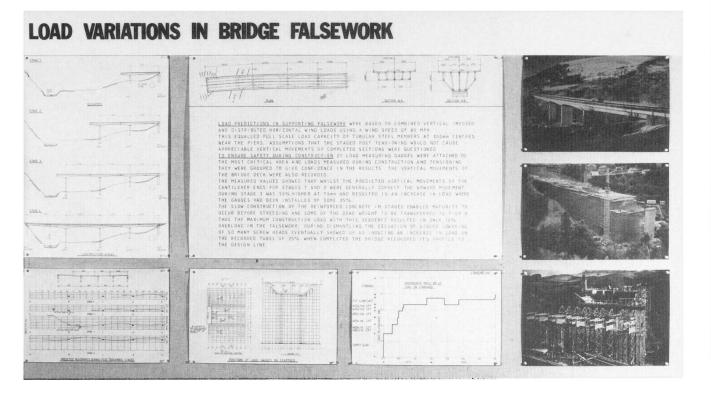

II - POSTERS