**Zeitschrift:** IABSE congress report = Rapport du congrès AIPC = IVBH

Kongressbericht

**Band:** 13 (1988)

**Artikel:** Fatigue of cross beam connections in steel bridges

Autor: Okura, Ichiro / Fukumoto, Yuhshi

DOI: https://doi.org/10.5169/seals-13076

#### Nutzungsbedingungen

Die ETH-Bibliothek ist die Anbieterin der digitalisierten Zeitschriften. Sie besitzt keine Urheberrechte an den Zeitschriften und ist nicht verantwortlich für deren Inhalte. Die Rechte liegen in der Regel bei den Herausgebern beziehungsweise den externen Rechteinhabern. Siehe Rechtliche Hinweise.

#### **Conditions d'utilisation**

L'ETH Library est le fournisseur des revues numérisées. Elle ne détient aucun droit d'auteur sur les revues et n'est pas responsable de leur contenu. En règle générale, les droits sont détenus par les éditeurs ou les détenteurs de droits externes. <u>Voir Informations légales.</u>

# Terms of use

The ETH Library is the provider of the digitised journals. It does not own any copyrights to the journals and is not responsible for their content. The rights usually lie with the publishers or the external rights holders. See Legal notice.

**Download PDF:** 17.05.2025

ETH-Bibliothek Zürich, E-Periodica, https://www.e-periodica.ch



## **Fatigue of Cross Beam Connections in Steel Bridges**

Fatigue des liaisons traverses-poutres principales des ponts en acier

Ermüdung der Querträger-Anschlüsse bei Stahlbrücken

Res. Assoc. Osaka University, Osaka, Japan



Ichiro Okura, born 1955, received his B. Sc., M. Sc. and Dr. Eng. degrees in civil engineering from Osaka University in 1977, 1979 and 1985.

Yuhshi FUKUMOTO
Prof. of Civil Eng.
Osaka University,
Osaka, Japan



Yuhshi Fukumoto, born 1932, received his M. Sc. degree in civil engineering from Kyoto University and Ph. D. degree from Lehigh University. He has held professorship at Nagoya University from 1963 to 1986.

# **SUMMARY**

Fatigue cracks are often initiated at the connections of cross beams to main girders in plate girder bridges. The stress states at the cross beam connections are revealed by the static loading test of an actual plate girder bridge. The local stresses which induce fatigue cracks are related quantitatively to the three-dimensional behavior of the bridge.

### RÉSUMÉ

Les fissures de fatigue apparaissent souvent dans les liaisons entre les traverses et les poutres principales de ponts à poutres métalliques. L'état des contraintes dans la liaison est donné par un essai de charge statique d'un pont en service. Les contraintes locales qui provoquent les fissures de fatigue dépendent du comportement tridimensionnel du pont.

#### ZUSAMMENFASSUNG

Bei Vollwandbalkenbrücken sind zwischen den Quer- und den Hauptträgern oft Ermüdungsrisse vorhanden. Die Spannungszustände wurden im statischen Belastungsversuch an einer Vollwandbalkenbrücke im Gebrauchszustand untersucht. Die lokalen Spannungen, die die Ermüdungsrisse hervorrufen, hängen qualitativ mit dem dreidimensionalen Verhalten der Brücke zusammen.



#### 1. INTRODUCTION

In many steel bridges, fatigue cracks are observed at the connections of main members with secondary members such as cross beams, sway bracings and lateral bracings [1]. Such fatigue cracks are caused by locally induced stresses not generally considered in the bridge design practice. Usually it is very difficult to predict the local stresses, because they are produced by the three-dimensional behavior of the bridge.

This paper deals with the relation between the local stresses and the three-dimensional behavior of plate girder bridges. In plate girder bridges, as shown in Fig.1, the following four types of fatigue cracks are detected at the connections of cross beams to main girders [2]:

- Type 1: This is initiated either on the bead or at the toe of the end return of the fillet weld between the connection plate and the top flange of the main girder.
- Type 2: This is initiated at the upper scallop of the connection plate, and grows diagonally through the connection plate itself.
- Type 3: This is initiated at the toe of the end return of the fillet weld connecting the connection plate to the main girder web, and grows downward along the toe on the connection plate side.
- Type 4: This is initiated and grows along the toe on the web side of the fillet weld between the top flange and the web of the main girder.

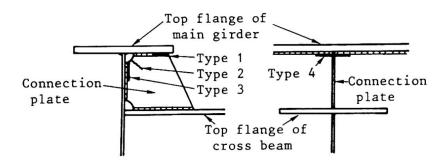


Fig.1 Fatigue cracks at cross beam connection

The difference in vertical displacement between main girders and the deformation of a concrete slab are pointed out as the main cause of the fatigue cracks [3,4]. However, until now it is not clear how these factors are related to the local stresses which induce the fatigue cracks.

#### 2. STRESS MEASUREMENT OF PLATE GIRDER BRIDGE

### 2.1 General View of Plate Girder Bridge

In order to know the stress states at cross beam connections in plate girder bridges, stress measurement of an actual plate girder bridge shown in Fig.2 has been carried out [5]. It is a simply-supported composite plate girder bridge with a span length of 28.4 m and total width of 17.6 m, which was designed by the Japanese Specification for Highway Bridges. The bridge has five main girders, a cross beam in the middle of the span and six sway bracings. The concrete slab is 180 mm thick. The bridge was opened to traffic in 1970. Repair and reinforcement works for the slab were done in 1979. A steel plate 4.5 mm thick was attached to the bottom surface of the slab, and some stringers were installed, as shown by dotted lines in Fig.2.

The loading truck and its loading positions are shown in Figs. 3 and 4, respectively. Four cases of A, B, C and D were considered according to the intervals



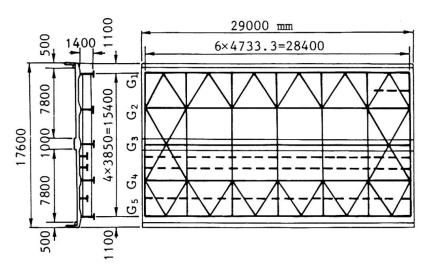


Fig. 2 General view of plate girder bridge

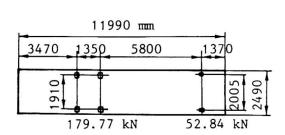


Fig. 3 Loading truck

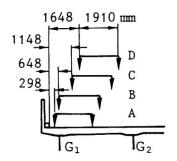


Fig. 4 Loading positions of truck

between the coping and the center of the rear double-tires on the left side. The static stress measurement was done at 11 locations in the longitudinal bridge-axis direction for each loading case. 24 one-directional, 214 two-directional and 126 three-directional strain gauges were attached on the cross beam connections at  $G_1$  and  $G_2$  girders.

### 2.2 Stress States at Connection Plates

The stress measurement results show that the plate-bending strains are much smaller than the membrane ones at the connection plates. Accordingly, the membrane stress is considered to be influential for the initiation of Types 1, 2 and 3 fatigue cracks. Figure 5 shows the principal membrane stresses when the center of the rear two wheel axles exists just above the cross beam in the loading case D. A relatively large compressive principal stress occurs around the

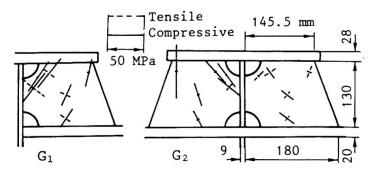


Fig. 5 Principal membrane stresses of connection plates



scallop of the connection plate of  $G_1$  girder and also at the left edge of the left connection plate of  $G_2$  girder. The direction of the principal stress at the connection plate edge is almost vertical, and it is perpendicular to the direction of the propagation of Type 1 fatigue crack.

# 2.3 Stress States at Main Girder Webs

Referring to Fig.6, the components of plate-bending stress  $\sigma_{by}$  and membrane stress  $\sigma_{my}$  are significant for Type 4 fatigue crack, because they act perpendicularly to the direction of the propagation of the crack. Figure 7 shows the distributions of  $\sigma_{by}$  and  $\sigma_{my}$  along the x-axis at y=16 mm from the bottom surface of the flange plate. The plate-bending stress  $\sigma_{by}$  takes the large values between the connection plate at x=0 and the tip of the top flange of the cross beam at the section I-I (x=225 mm), and increases gradually toward the connection plate. The membrane stress  $\sigma_{my}$  changes sharply from compressive to tensile stress in the very vicinity of the connection plate. The ratios of  $\sigma_{my}$  to  $\sigma_{by}$  at the point of x=24.5 mm and y=16 mm where the strain gauges were glued nearest to the connection plate, vary from 20 % to 26 % depending on the loading cases.

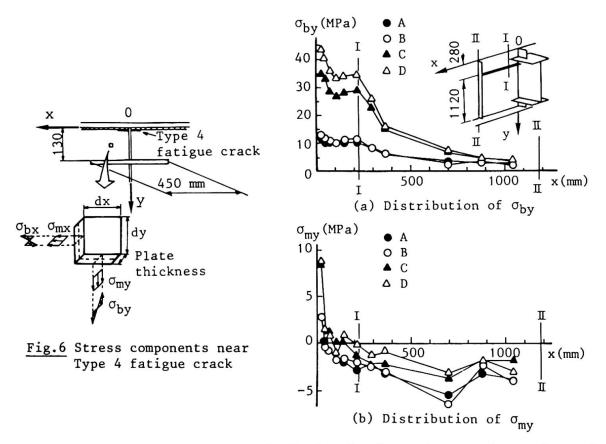
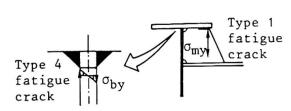


Fig. 7 Distributions of  $\sigma_{by}$  and  $\sigma_{my}$  along the x-axis at y=16 mm of  $G_1$  girder web

### 3. ESTIMATION OF LOCAL STRESSES

From the stress measurement of a plate girder bridge, the membrane stress  $\sigma_{my}$  and the plate-bending stress  $\sigma_{by}$  illustrated in Fig.8 are the governing stresses for the initiation of Types 1 and 4 fatigue cracks, respectively. Referring to Fig.9, they are caused by the respective rotations  $\theta_{s}$  and  $\theta_{g}$  of the concrete slab and cross beam and by their respective horizontal displacements  $u_{s}$  and  $u_{g}$ . Through the plate-bending analysis of the slab and the three-dimensional F.E.M. analysis of the whole bridge, the equation to estimate the local stresses of





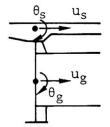


Fig.8 Fatigue crack types and local stresses

Fig. 9 Notation

 $\sigma_{my}$  and  $\sigma_{by}$  has been obtained as follows:

$$\begin{bmatrix} \sigma_{my} \\ \sigma_{by} \end{bmatrix} = \begin{bmatrix} k_{m1} & k_{m3}(\gamma - k_{m123}) \\ k_{b1} & k_{b3}(\gamma - k_{b123}) \end{bmatrix} \begin{bmatrix} \theta_{s0} \\ \theta_{g} \end{bmatrix}$$
(1)

where  $\theta_{s0}$  is the rotation of a slab due to its plate-bending deformation excluding the deformation of the slab produced by the different vertical deflections of main girders,  $\theta_g$  is the rotation of a cross beam caused by the different vertical deflections of main girders,  $\gamma$  is a coefficient defined by  $(u_s - u_g)/\theta_g$  and it takes different values depending on the positions of the truck loading along the width of the roadway, and  $k_{m1}$ ,  $k_{m3}$ ,  $k_{m123}$ ,  $k_{b1}$ ,  $k_{b3}$  and  $k_{b123}$  are coefficients which relate the local stresses  $\sigma_{my}$  and  $\sigma_{by}$  to the corresponding rotations  $\theta_{s0}$  and  $\theta_{g}$  [6].

Figure 10 shows a comparison of the values estimated by Eq.(1) with the measured ones when the loading truck moves along the longitudinal bridge-axis in the loading case D. It can be seen that Eq.(1) is very close to the measured values.

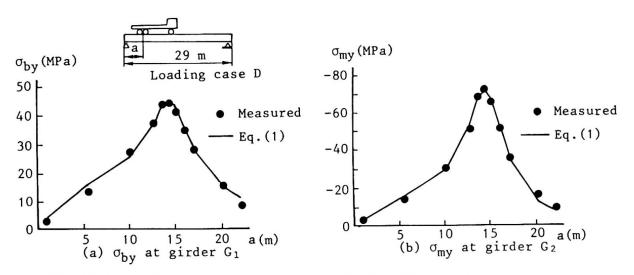


Fig. 10 Comparisons between the values by Eq. (1) and the measured ones

Figure 11, which has been theoretically obtained by Eq.(1), shows the effects of the rotations  $\theta_{s0}$  and  $\theta_{g}$  on the local stresses  $\sigma_{by}$  and  $\sigma_{my}$  when a concentrated load P=9.81 kN moves on the slab along the cross beam between  $G_1$  and  $G_2$  girders. When the load is in the middle part between  $G_1$  and  $G_2$  girders,  $\sigma_{by}$  can be mainly induced by the term  $\theta_{s0}$ , and on the contrary, when it moves near  $G_1$  or  $G_2$  girder,  $\sigma_{by}$  mainly induced by the term  $\theta_{g}$ . The membrane stress  $\sigma_{my}$  is mainly induced by the term  $\theta_{s0}$ . That is, the rotations of a slab due to its plate-bending deformation and of a cross beam caused by the different vertical deflections of main girders are equally influential for Type 4 fatigue crack, while only the former has a great influence on Type 1 fatigue crack.



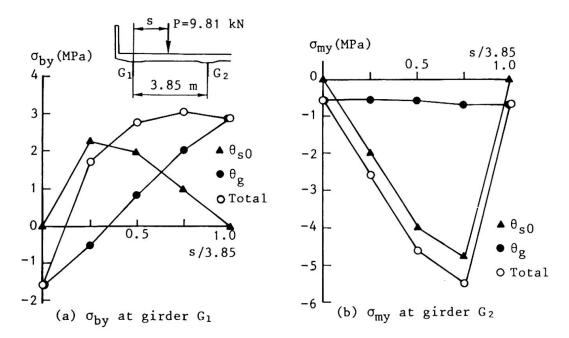


Fig. 11 Effects of  $\theta_{s0}$  and  $\theta_{g}$  on  $\sigma_{by}$  and  $\sigma_{my}$ 

### 4. CONCLUSIONS

In this paper, the stress states at the connections of cross beams to main girders in plate girder bridges were revealed by the static loading test of an actual plate girder bridge. The local stresses which induce fatigue cracks were related quantitatively to the three-dimensional behavior of the bridge.

## REFERENCES

- FISHER J.W., Fatigue and Fracture in Steel Bridges, John Wiley & Sons, Inc., 1984.
- 2. HANSHIN EXPRESSWAY PUBLIC CORP. and NAIGAIKOEI CO., LTD., Classification of Fatigue Cracks at Member Connections in Plate Girder Bridges, Mar., 1985. (in Japanese)
- 3. FISHER T.A., FISHER J.W., KOSTEM C.N. and MERTZ D.R., Design and Retrofit for Fatigue Damage in Web Gap, IABSE Colloquium, Lausanne, 1982, pp.535-543.
- 4. KATO S., YOSHIKAWA O., TERADA H. and MATSUMOTO Y., Studies on Fatigue Damages Based on Strain Measurements of a Highway Bridge, Proc. of JSCE Struct. Eng./Earthq. Eng., Vol.2, No.2, 1985, pp.445s-454s.
- 5. OKURA I., HIRANO H. and YUBISUI M., Stress Measurement at Cross Beam Connections of Plate Girder Bridge, Technol. Repts. Osaka Univ., Vol.37, No.1883, 1987, pp.151-160.
- OKURA I., YUBISUI M., HIRANO H. and FUKUMOTO Y., Local Stresses at Cross Beam Connections of Plate Girder Bridges, Submitted to Proc. of JSCE Struct. Eng./ Earthq. Eng.